

Date: Tuesday, 4/17/2007 11:17:13 AM
User: Kim Johnston

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	31875A		
Estimate Number :	10023		
P.O. Number :	N/A	Part Number :	D20563402
This Issue :	4/17/2007	S.O. No. :	N/A
Prsht Rev. :	NC	Drawing Number :	D2580 REV C
First Issue :	N/A	Project Number :	N/A
Previous Run :	31874A	Drawing Revision :	C
Written By :		Material :	N/A
Checked & Approved By :	<u>07.04.17</u>	Due Date :	5/12/2007
Comment :	Est Rev. N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev. O 06.02.28 Added paperwork EC		

Additional Product:

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL
Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG001

N/A 07.04.17

2.0	D25001190	Ext'n -I' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)
Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B 29602

3.0	D2596	205 Web
-----	-------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B 31517

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

- 1- Inspect mat'l D2500-1-190 for damage
- 2-Cut D2500-1-190 per Dwg D2580 if necessary Debur ends
- 3-Acid etch and Alodine tube per QSI 005 4.1
- 4-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

5b 7-4-23

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 4/17/2007 11:17:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31875A

Part Number: D205634041

Job Number:



Seq. #

Machine Or Operation:

Description:

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M103561

Sikaflex expire date: 7-10-1

Start Time: 11:30 Date: 7-4-23

Fin Time: 11:45 Date: 7-4-25

Job 7-4-23

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

EL/R

7-4-25

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

Job 7-4-30

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

7-4-25

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3

Step

B29486 BE 07-05-03

9.0

D2579

Crossbolt Spacer



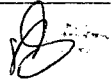

 

Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty Part Number Description Batch

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D205-634-045 PAR #: N/A Fault Category: Prod - LG NCR: Yes No DQA: Yes Date: 07.07.18
 QA: N/C Closed: Yes Date: 07.07.18

NCR: 31875A		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action		Section B	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07/04/09	#6.0	-041 Tube was drilled as per DE09183 but web was not	 AGFLD	Drill holes in web to match holes in tube ensure no sharp edges on web	Pm 07-05-09	 07-05-09	 07-05-09	 07-05-09

NOTE: Date & initial all entries

Date: Tuesday, 4/17/2007 11:17:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31875A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

+ 4 *

Description:

20 D2579

Spacers

B21108

BE 07-05-03

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 Step Remove alodine as required.

BE 07-05-03

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

M103794

BE 07-05-03

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M103794

BE 07-05-03

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

pm 07-05-070

5-Drill holes for wearplates using DT 8217 Open holes to 19/64", adjust stopper not to hit web. Deburr

pm 07-04-070

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

pm 07-04-070

7-Drill pilot holes for aft cap using DT 8215 Open holes to #6 Drill bit. Deburr

pm 07-05-070

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

pm 07-05-070

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

11/07/05/08

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

11/07/05/08

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

Fx

07/07/09 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 4/17/2007 11:17:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31875A

Part Number: D20563404

Job Number:



Seq. #:

Machine Or Operation:

Description:

14.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per OSI 005 4.3

Sancltex Green per OSI 005

4.3.5.8

Pressure wash FX 07/07/09

M18144 BK/FX 07-07-09

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M1 070710

(1)

16.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-1

Wearplate

B31212

17.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-3

Wearplate

B30551

18.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-5

Wearplate

B31254

19.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

44

ALS7-1032-130

Inserts

M103618

BS 07-07-09

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 4/17/2007 11:17:13 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31875A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN960JD10L	Washer	M103641

21.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN3-4A	Bolt	M104817

22.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: B29165

23.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: B27168

24.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B33447

25.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: B M100188

FL 07/07/12 01

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Tuesday, 4/17/2007 11:17:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 31875A

Part Number: D205634041

1045

Job Number:



Seq. #:

Machine Or Operation:

Description:

26.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M103641

21 0707-0 0

27.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M104616

Sikaflex expire date: 0709

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M104616

Sikaflex expire date: 0709

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

M104733

FL

Batch:

07/07/11 0

28.0

QC5

INSPECT WORK TO CURRENT STEP



210713 0



All Plugs are installed in the Skid

Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PPP 32955 7/7/16 SP

30.0

QC21

FINAL INSPECTION/W/O RELEASE



07.07.16

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



11 07.07.16

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries



RELEASED
98/09/17 DS

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576-3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER

98.08.28
UP 08.28

EFFECTIVE
DEOS
98/12/14
DEO 9124
DED 9183

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES *
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL $\varnothing 0.297$ HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 31875A

DETAIL B
SCALE 5:24

#00 08-78
D2576-3 U.S. 03-78

GRIND FLUSH (4 PLACES)

GRIND FLUSH

STEP

GRIND FLUSH

LOCATION RIDGE ON UNDERSIDE OF D2576

1/8"

DRILL PRIOR TO D2575 CAP
 INSTALLATION (2 PLACES)

SEAL WITH
 SIKAFLEX-241

AN3-4A BOLT (1)
 AN96JDIOL WASHER (1)
 (2 PLACES)

D2575 CAP

0.40

D2579 SPACER

D2596 WEB (REF)

ALS7-1032-130 (REF)
(TYP 44 PLACES)


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

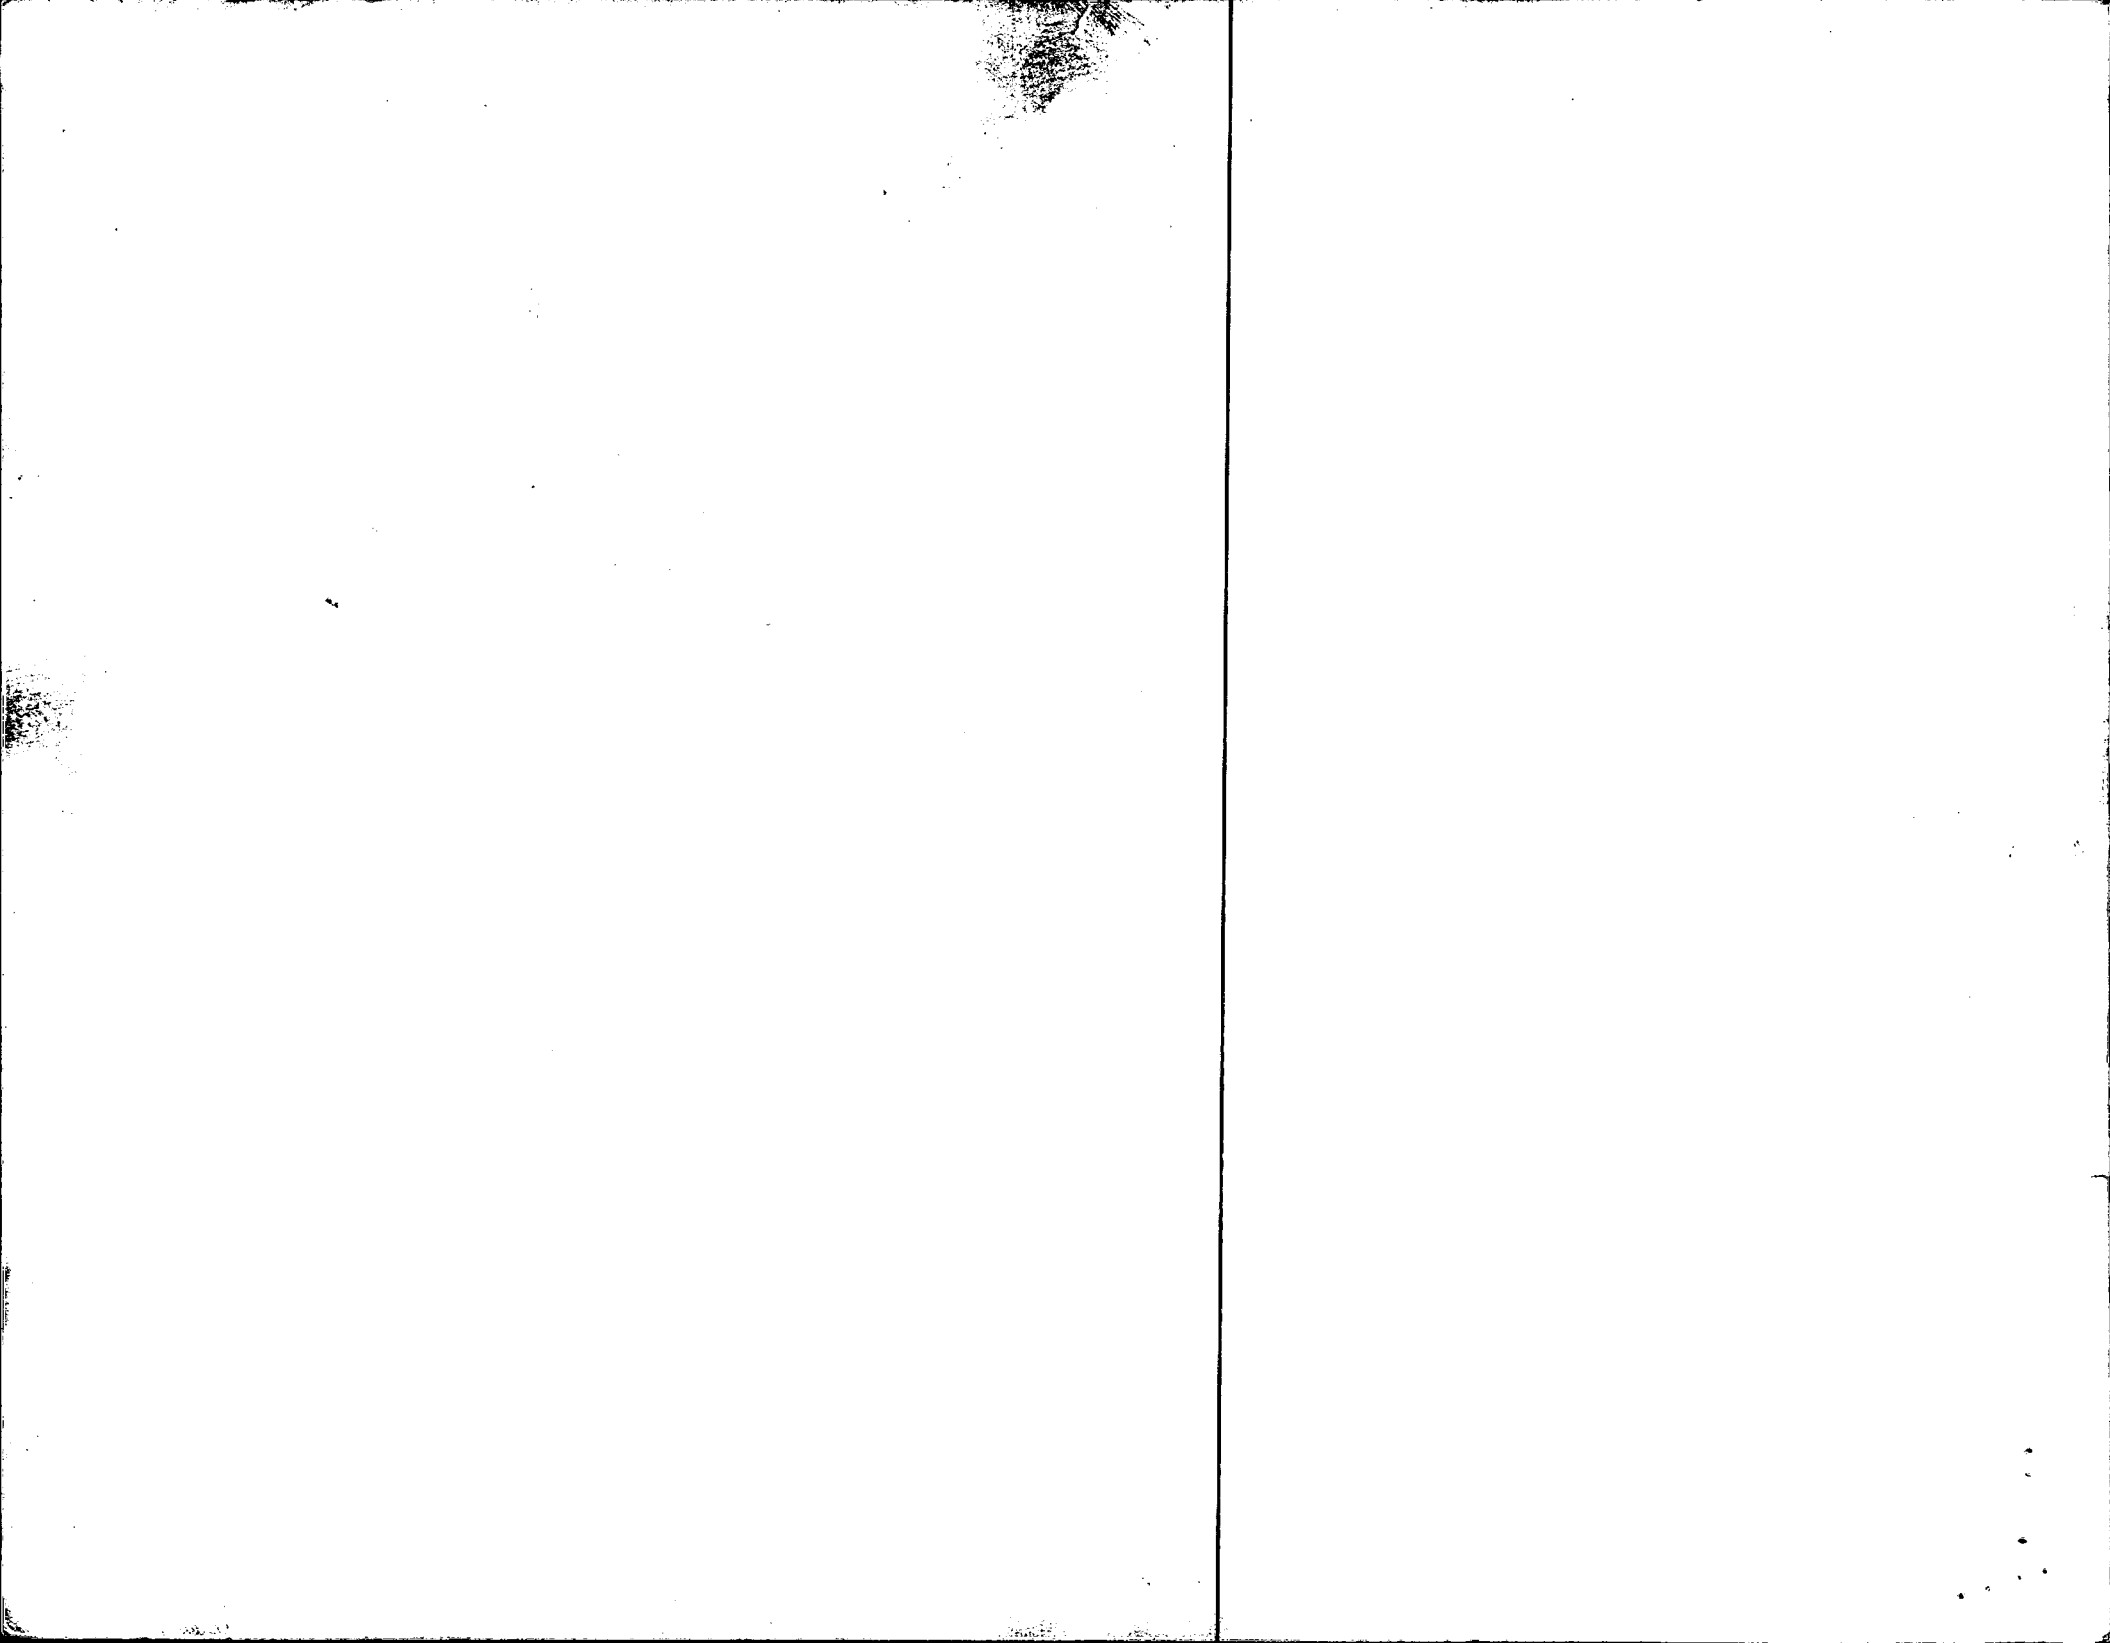
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO $\phi 0.437$ X 1.00 DEEP

37.50
DISTANCE TO AFT END
OF D2596 WEB
3
7
1.750
1.750
#0.508 (TYP.)
(40 PLACES)
REFER TO DETAIL A
REFER TO DETAIL A
8.750
17.375
26.000
34.188
57.313 (REF)
7 EQUAL SPACES
8.188 PITCH
38.0
91.500
190.0
(D2500-1)

[illegible]

RELEASE
98/09/17 DS

DESIGN <i>DH</i>	DRAWN BY <i>CP</i>	 DART AEROSPACE LTD HUNTSBURY, ONTARIO, CANADA
CHECKED <i>DH</i>	APPROVED <i>CS</i>	
DATE 98.08.26	DRAWING NO. D2580	REV. C SHEET 2 OF 2
	TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24



NO. 107

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A205 634041 / B 318764

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/04/27 Qualifier Lawrence

